

Site Accessibility Evaluation

Americans with Disabilities Act Title II (Public Services: State and Local Government)



Costilla Parking Garage

50 E Costilla St
Colorado Springs, CO
80903

Accessibility Evaluation

Inspection Date: 08/05/2019

Inspector: David Mejia

Prepared By



(719) 520 - 6866

www.elpasoco.com

4th Floor Accessible Parking Stall/s

Lat: 38.8287270000, Long: -104.8242122000

Finding: 1

The access aisle is on the driver's side of the stall.

Access aisles must be located on the passenger side of the stall for angled van accessible stalls.

2010 ADAS Section 502.3.4

Access aisles shall not overlap the vehicular way. Access aisles shall be permitted to be placed on either side of the parking space except for angled van parking spaces which shall have access aisles located on the passenger side of the parking spaces.

Citation:

2010 ADAS Section: 502.3.4

As Built:

Access aisle on driver's side (angled parking stall)

Budgeting Range:

\$0 - \$0.00

Recommendation:

Remove "van accessible" signage from 2nd stall. Van access aisles must be on passenger side for angled parking stalls.

Barrier Priority:

1 (High): Should be completed immediately. (Includes; Findings that have little or no cost, were in violation of the codes at the time of construction, or pose an imminent safety threat)

Department:

N/A


Estimated Remediation Date:

N/A

Notes:

N/A

Finding #1 Continued

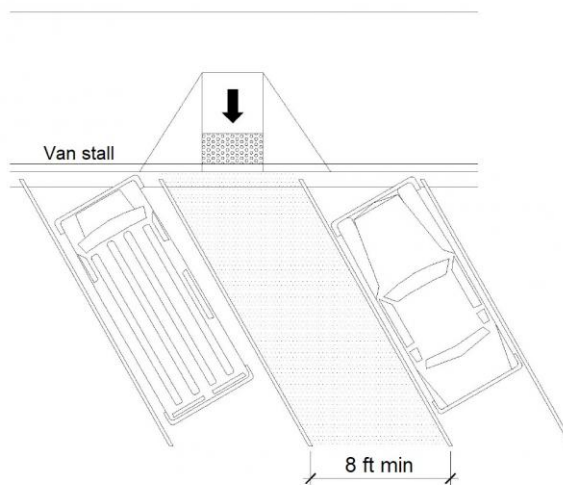

Finding 297287 Main Photo